



Office of the District Fire Officer
South Fire Station.
Karnataka Fire & Emergency Services,
Ashok Nagar Bengaluru-560 025



~~Office Of the District Fire Officer~~

South Fire Station, Bangalore-560025

Date Dated:-21-12-2023

No:13 /FSCR/DFO/SFS/BLR-2023

To
The Managing Trustee,
Nurture International School (Block A),
(The Sunrise Educational Trust)
No.14/3, 9th mile stone,
Hessarghatta main road,
Bengaluru-560073.

Sir,

Sub : Issue of 'Fire safety compliance' report to Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073."

Ref : 1. Your Letter Dated:11-12-2023
2. No:15/FSCR/DFO/SFS/BLR-2023 Dated:-21-12-2023.
3. Inspection Report No.12 /FSO/SFS-CC/2023, Date:-15-12-2023.

*****@*****

With reference to the subject above cited (1) "Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" has requested to "Fire Safety Compliance Report".

As per reference (2) the Fire Safety recommendations report was issued by this office and as per reference (3) the premises of "Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" was inspected by Fire Station Officer, South Fire Station on 15-12-2023 with respect to fire safety compliance report of the above said school building.

The applicant has maintained all the firefighting systems. Under the above Circumstances the Karnataka Fire & Emergency Services Department issuing "**Fire Safety Compliance Report**" to "Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" Subject to proper maintenance of firefighting installations in good working conditions and impart 40% training part within 90days from the date of issue of this report "This report is valid for one year from the date of issue and is renewable without fail".

Yours Faithfully

Copy to:

➤ Fire station officer, South Fire station, Bangalore-560001

DISTRICT FIRE OFFICER



Office of the District Fire Officer,
South Fire Station.
Karnataka Fire & Emergency Services,
Ashok Nagar, Bengaluru-560 025.



Office Of the District Fire Officer
South Fire Station, Bangalore-560025

No:-15/FSR/DFO/SFS/BLR-2023

Date Dated: 21-12-2023..

To
The Managing Trustee,
Nurture International School (Block A),
(The Sunrise Educational Trust)
No.14/3, 9th mile stone,
Hessarghatta main road,
Bengaluru-560073.

Sir,

Sub : Issue of 'Fire safety recommendations' to Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073.

Ref :No. 13/FSO/SFS-FSR/2023, Date:15-12-2023.

><◇◇@*◇◇<

With reference to the subject above cited, the premises of Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073, was inspected by The Fire station Officer, South Fire Station, Bangalore on 15-12-2023 with respect to Fire prevention, Firefighting and Evacuation measures to be complied in the above premises and has submitted the details as under.

Group B Educational Building

NBC-2016, Part-4, Table 7 (11) 3.1.3 Group B Educational Buildings Sub division B1 & B2.
(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC 2016 are mandatory)

A. Details of the building / premises :-

01.	Name and Address of the Applicant.	:	The Managing Trustee, Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9 th mile stone, Hessarghatta main road, Bengaluru-560073.
02.	Name and Address of the premises.	:	Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9 th mile stone, Hessarghatta main road, Bengaluru-560073.
03.	Name & address of the building owner	:	Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9 th mile stone, Hessarghatta main road, Bengaluru-560073.

04.	Number of buildings	:	One Building, Block-A
05.	Number of floors	:	Block-A: Basement, Ground and 3 upper floors
06.	<u>Floor-wise details of occupancy:-</u>		
	<u>Block-A:</u>		
	Basement Floor	:	02 store room, 02 sports rooms,
	Ground floor	:	02 staff rooms, 06 Class rooms and 2 Toilet
	1 st floor	:	1 Computer room, 02 labs, 08 Class room and 2 Toilet
	2 nd floor	:	08 Class rooms, 02 labs, 01 library, and 1 Toilet
	3 rd floor	:	10 Class rooms and 1 Toilet
07.	Height of the building	:	Block-A: 14.90 Mtrs.
08.	Site area	:	7536.32 Sq.Mtrs.
09.	<u>Built-up area of each floor:-</u>		
	<u>Block-A</u>		
	Basement Floor	:	730.80 Sq. Mtrs
	Ground floor	:	853.41 Sq. Mtrs.
	1 st floor	:	853.41 Sq. Mtrs.
	2 nd floor	:	853.41 Sq. Mtrs.
	3 rd floor	:	853.41 Sq. Mtrs.
	Total Built-up area	:	4144.44 Sq. Mtrs.
11.	<u>Surrounding properties:-</u>		
	<u>Block-A</u>		
	East (Front)	:	Hessarghatta main road,
	West (Rear)	:	Private property
	North (Side)	:	Private property
	South (Side)	:	Block B building
12.	<u>Open space all around the building:-</u>		
	<u>Block-A</u>		
	East (Front)	:	40.50 Mtrs.
	West (Rear)	:	05.20 Mtrs.
	North (Side)	:	04.00Mtrs.
	South (Side)	:	02.50Mtrs.
	Allowed setbacks (open space) should be maintained free from further obstruction / construction		

04.	Number of buildings	:	One Building, Block-A
05.	Number of floors	:	Block-A: Basement, Ground and 3 upper floors
06.	<u>Floor-wise details of occupancy:-</u>		
	<u>Block-A:</u>		
	Basement Floor	:	02 store room, 02 sports rooms,
	Ground floor	:	02 staff rooms, 06 Class rooms and 2 Toilet
	1 st floor	:	1 Computer room, 02 labs, 08 Class room and 2 Toilet
	2 nd floor	:	08 Class rooms, 02 labs, 01 library, and 1 Toilet
	3 rd floor	:	10 Class rooms and 1 Toilet
07.	Height of the building	:	Block-A: 14.90 Mtrs.
08.	Site area	:	7536.32 Sq.Mtrs.
09.	<u>Built-up area of each floor:-</u>		
	<u>Block-A</u>		
	Basement Floor	:	730.80 Sq. Mtrs
	Ground floor	:	853.41 Sq. Mtrs.
	1 st floor	:	853.41 Sq. Mtrs.
	2 nd floor	:	853.41 Sq. Mtrs.
	3 rd floor	:	853.41 Sq. Mtrs.
	Total Built-up area	:	4144.44 Sq. Mtrs.
11.	<u>Surrounding properties:-</u>		
	<u>Block-A</u>		
	East (Front)	:	Hessarghatta main road,
	West (Rear)	:	Private property
	North (Side)	:	Private property
	South (Side)	:	Block B building
12.	<u>Open space all around the building:-</u>		
	<u>Block-A</u>		
	East (Front)	:	40.50 Mtrs.
	West (Rear)	:	05.20 Mtrs.
	North (Side)	:	04.00Mtrs.
	South (Side)	:	02.50Mtrs.
	Allowed setbacks (open space) should be maintained free from further obstruction / construction		

B. On inspection of this School/College premises, the following fire prevention, firefighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl. No. (1)	Details (02)	Existing (03)	Recommendations (04)
01.	Accessibility to the Premises	The premises is approachable from 14.00mtrs wide Hessarghatta main road, located on the Northern side and the road is hardened to carry weight of 45,000kgs.	Complied.
02.	Number of entrances	01 Entrance cum exit of 6.00mtrs. width has been provided.	Complied.
03.	Number of staircase	Nos. of staircases : 2 No's	Complied.
		Width of staircases : 1.50Mtr. 1.00Mtr.	
		Width of treads : Each of 30 Cms	
		Height of risers : Each of 15 Cms	
		Nos. of riser per flight : Each of 10 nos	
		Height of handrails : 1.00	
04.	Portable extinguishers	22 No's ABC type fire extinguisher of 06 kgs capacity have been provided and available within 15 mtrs. radius in and 08 No's CO2 type fire extinguisher, of 4.5 kgs capacity have been provided near each electrical panel board & electrical room in Block-A building.	Complied.
05.	Hose reel hose system	05 No's of Hose Reel Hoses near the staircase at both Block-A (One hose reel hose system for every 1000 Sq. mtrs). Thehose reel hose of min 19 mm size and of 30.00 mtrs length have been provided to reach the farthest point of each floor and shut off branch having a nozzle of 5mm size. The hose reel hose have been connected at each landing.	Complied.
06.	At the terrace tank level with	The hose reel hose system have been connected to a booster pump capable of	

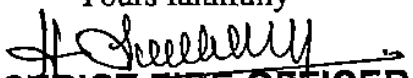
07	Diesel generator	Suitable alternative power supply (DG) have been provided & connected all the emergency provisions in Block-A	Complied.
08.	Terrace tank	The system have been connected to an overhead tank of 10,000 ltrs. Capacity in block A	Complied.
09	Escape routes	Direction in which the students have to move in the event of an emergency have been displayed in the corridor on each floor during evacuation	Complied.
10.	Fire order (Fire safety plans)	Notice boards, indicating with the details of action to be taken by the Staff/Students in case of an emergency/Fire have been displayed in Block-A at each floor with telephone numbers of south Fire Station i.e. 080-22971535 & Central Fire Control Room i.e. 22971500, 22971550 22971600 & 101 and of nearby Ambulance Service.	Complied.
11.	No smoking board	COTPA Sec-4 direction No Smoking area smoking here is an offence board have been written in English & Kannada both language have been prominently displayed in Block-A building at inside the entry / exit of the each floor.	Complied.
12	Fire Siren	A Fire Siren have been installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.	Complied.
13	Nominate one Fire Nodal Officer	A fire nodal officer have been nominated from teaching staff.	Complied.
14.	Fire fighting training	Not trained	At least 40% of Teaching and non Teaching staff should be got trained in basic fire fighting at R.A. Mundkur Fire and Emergency Services Academy, Bannerughatta road, Bangalore or Regional Training centre
15.	Fire precautionary measures :- A. Explosive and flammable materials should not be stored in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises.		

- B. Accumulation of combustible waste in and around the premises should be avoided.
- C. The exit ways shall be always kept clear without any obstruction.
- D. Liquefied petroleum gas should not be stored in the building.
- E. The doors shall not be kept locked / latched during working hours and shall be free from obstruction.
- F. During the class hours the class room doors shall not be locked from inside to outside.
- G. As per Hon'ble Supreme Court order all teachers and staffs shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety Day on April 14th of every year by conducting Fire Safety drills with co-ordinate with fire service department.

Under the above circumstance the Karnataka Fire & Emergency Service Department is issuing 'Fire Safety Recommendations' to "Nurture International School (Block A), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" Subject to conditional compliance of the above recommendations in column -4 of serial - B within 3 months and submit compliance to the undersigned.

This "Fire Safety Recommendations" valid for only one year from the date of issue and it is renewable.

Yours faithfully


DISTRICT FIRE OFFICER
SOUTH FIRE STATION
Bangalore - 560 025

Copy to:

- Fire station officer, South Fire station, Bangalore-560025.



Office of the District Fire Officer
South Fire Station.
Karnataka Fire & Emergency Services,
Ashok Nagar Bengaluru-560025



Office Of the District Fire Officer
South Fire Station, Bangalore-560025

No:14 /FSCR/DFO/SFS/BLR-2023

DateDated:-21-12-2023

To
The Managing Trustee,
Nurture International School (Block B),
(The Sunrise Educational Trust)
No.14/3, 9th mile stone,
Hessarghatta main road,
Bengaluru-560073.

Sir,

Sub : Issue of 'Fire safety compliance' report to Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073."

Ref : 1. Your Letter Dated:11-12-2023
2. No:15 /FSR/DFO/SFS/BLR-2023 Dated:-21-12-2023.
3. Inspection Report No.12 /FSO/SFS-CC/2023, Date:-15-12-2023.

*****@*****

With reference to the subject above cited (1) "Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" has requested to "Fire Safety Compliance Report".

As per reference (2) the Fire Safety recommendations report was issued by this office and as per reference (3) the premises of "Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" was inspected by Fire Station Officer, South Fire Station on 15-12-2023 with respect to fire safety compliance report of the above said school building.

The applicant has maintained all the firefighting systems. Under the above Circumstances the Karnataka Fire & Emergency Services Department issuing "Fire Safety Compliance Report" to "Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" Subject to proper maintenance of firefighting installations in good working conditions and impart 40% training part within 90days from the date of issue of this report "This report is valid for one year from the date of issue and is renewable without fail".

Yours Faithfully


DISTRICT FIRE OFFICER

Copy to:

➤ Fire station officer, South Fire station, Bengaluru-560025



Office of the District Fire Officer,
South Fire Station.
Karnataka Fire & Emergency Services,
Ashok Nagar, Bengaluru-560 025



Office Of the District Fire Officer
South Fire Station, Bangalore-560025

No:-15/FSR/DFO/SFS/BLR-2023

Date:Dated: 21-12-2023..

To
The Managing Trustee,
Nurture International School (Block B),
(The Sunrise Educational Trust)
No.14/3, 9th mile stone,
Hessarghatta main road,
Bengaluru-560073.

Sir,

Sub : Issue of 'Fire safety recommendations' to Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073.

Ref :No. 13/FSO/SFS-FSR/2023, Date:-21-12-2023.

><<<*@*><<<

With reference to the subject above cited, the premises of Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073, was inspected by The Fire station Officer, South Fire Station, Bangalore on 15-12-2023 with respect to Fire prevention, Firefighting and Evacuation measures to be complied in the above premises and has submitted the details as under.

Group B Educational Building

NBC-2016, Part-4, Table 7 (11) 3.1.3 Group B Educational Buildings Sub division B1 & B2.
(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC 2016 are mandatory)

B. Details of the building / premises :-

01.	Name and Address of the Applicant.	:	The Managing Trustee, Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9 th mile stone, Hessarghatta main road, Bengaluru-560073.
02.	Name and Address of the premises.	:	Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9 th mile stone, Hessarghatta main road, Bengaluru-560073.
03.	Name & address of the building owner	:	Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9 th mile stone.

04.	Number of buildings	:	One Building, Block-B
05.	Number of floors	:	Block-B: Stilt , Ground and 3 upper floors
06.	<u>Number of Classrooms Occupancy:-</u>		
	<u>Block-B:</u>		
	Stilt Floor	:	04 office rooms, 01 principal room, 02 wash rooms
	Ground floor	:	08 Class rooms and 2 Toilet
	1 st floor	:	10 Class room and 2 Toilet
	2 nd floor	:	10 Class rooms, 01 library, and 2 Toilet
	3 rd floor	:	06 Class rooms and 01 auditorium
07.	Height of the building	:	Block-B: 14.60 Mtrs.
08.	Site area	:	7536.32 Sq.Mtrs.
09.	<u>Built-up area of each floor:-</u>		
	<u>Block-B:</u>		
	Stilt Floor	:	730.80 Sq. Mtrs
	Ground floor	:	853.41 Sq. Mtrs.
	1 st floor	:	853.41 Sq. Mtrs.
	2 nd floor	:	853.41 Sq. Mtrs.
	3 rd floor	:	853.41 Sq. Mtrs.
	Total Built-up area	:	4144.44 Sq. Mtrs.
11.	<u>Surrounding properties:-</u>		
	<u>Block-B</u>		
	East (Front)	:	Hessarghatta main road,
	West (Rear)	:	Private property
	North (Side)	:	Block A building
	South (Side)	:	Private property
12.	<u>Open space all around the building:-</u>		
	<u>Block-B</u>		
	East (Front)	:	40.50 Mtrs.
	West (Rear)	:	05.20 Mtrs.
	North (Side)	:	04.00Mtrs.
	South (Side)	:	02.50Mtrs.
Allowed setbacks (open space) should be maintained free from further obstruction / construction			

D

B. On inspection of this School/College premises, the following fire prevention, firefighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl. No. (1)	Details (02)	Existing (03)	Recommendations (04)																		
01.	Accessibility to the Premises	The premises is approachable from 14.00mtrs wide Hessarghatta main road, located on the Northern side and the road is hardened to carry weight of 45,000kgs.	Complied.																		
02.	Number of entrances	01 Entrance cum exit of 6.00mtrs. width has been provided.	Complied.																		
03.	Number of staircase	<table border="1"> <tr> <td>Nos. of staircases</td> <td>:</td> <td>2 No's</td> </tr> <tr> <td>Width of staircases</td> <td>:</td> <td>1.50Mtr. 1.00Mtr.</td> </tr> <tr> <td>Width of treads</td> <td>:</td> <td>Each of 30 Cms</td> </tr> <tr> <td>Height of risers</td> <td>:</td> <td>Each of 15 Cms</td> </tr> <tr> <td>Nos. of riser per flight</td> <td>:</td> <td>Each of 10 nos</td> </tr> <tr> <td>Height of handrails</td> <td>:</td> <td>1.00</td> </tr> </table>	Nos. of staircases	:	2 No's	Width of staircases	:	1.50Mtr. 1.00Mtr.	Width of treads	:	Each of 30 Cms	Height of risers	:	Each of 15 Cms	Nos. of riser per flight	:	Each of 10 nos	Height of handrails	:	1.00	Complied.
Nos. of staircases	:	2 No's																			
Width of staircases	:	1.50Mtr. 1.00Mtr.																			
Width of treads	:	Each of 30 Cms																			
Height of risers	:	Each of 15 Cms																			
Nos. of riser per flight	:	Each of 10 nos																			
Height of handrails	:	1.00																			
04.	Portable extinguishers	22 No's ABC type fire extinguisher of 06 kgs capacity have been provided and available within 15 mtrs. radius in and 08 No's CO2 type fire extinguisher, of 4.5 kgs capacity have been provided near each electrical panel board & electrical room in Block-B building.	Complied.																		
05.	Hose reel hose system	05 No's of Hose Reel Hoses near the staircase at both Block-B (One hose reel hose system for every 1000 Sq. mtrs). The hose reel hose of min 19 mm size and of 30.00 mtrs length have been provided to reach the farthest point of each floor and shut off branch having a nozzle of 5mm size. The hose reel hose have been connected at each landing.	Complied.																		
06.	At the terrace tank level with minimum	The hose reel hose system have been connected to a booster pump capable of delivering 450liters of water per minute	Complied.																		

07	Diesel generator	Suitable alternative power supply (DG) have been provided & connected all the emergency provisions in Block-B	Complied.
08.	Terrace tank	The system have been connected to an overhead tank of 10,000 ltrs. Capacity in block B	Complied.
09	Escape routes	Direction in which the students have to move in the event of an emergency have been displayed in the corridor on each floor during evacuation	Complied.
10.	Fire order (Fire safety plans)	Notice boards, indicating with the details of action to be taken by the Staff/Students in case of an emergency/Fire have been displayed in Block-B at each floor with telephone numbers of south Fire Station i.e. 080-22971535 & Central Fire Control Room i.e. 22971500, 22971550 22971600 & 101 and of nearby Ambulance Service.	Complied.
11.	No smoking board	COTPA Sec-4 direction No Smoking area smoking here is an offence board have been written in English & Kannada both language have been prominently displayed in Block-B building at inside the entry / exit of the each floor.	Complied.
12	Fire Siren	A Fire Siren have been installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.	Complied.
13	Nominate one Fire Nodal Officer	A fire nodal officer have been nominated from teaching staff.	Complied.
14.	Fire fighting training	Not trained	At least 40% of Teaching and non Teaching staff should be got trained in basic fire fighting at R.A. Mundkur Fire and Emergency Services Academy, Bannerughatta road, Bangalore or Regional Training centre
15.	<u>Fire precautionary measures :-</u> H. Explosive and flammable materials should not be stored in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises.		

I. Accumulation of combustible waste in and around the premises should be avoided.

J. The exit ways shall be always kept clear without any obstruction.

K. Liquefied petroleum gas should not be stored in the building.

L. The doors shall not be kept locked / latched during working hours and shall be free from obstruction.


M. During the class hours the class room doors shall not be locked from inside to outside.

N. As per Hon'ble Supreme Court order all teachers and staffs shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety Day on April 14th of every year by conducting Fire Safety drills with co-ordinate with fire service department.

Under the above circumstance the Karnataka Fire & Emergency Service Department is issuing 'Fire Safety Recommendations' to "Nurture International School (Block B), (The Sunrise Educational Trust), No.14/3, 9th mile stone, Hessarghatta main road, Bengaluru-560073" Subject to conditional compliance of the above recommendations in column -4 of serial - B within 3 months and submit compliance to the undersigned.

This "Fire Safety Recommendations" valid for only one year from the date of issue and it is renewable.

Yours faithfully


DISTRICT FIRE OFFICER
SOUTH FIRE STATION
Bangalore - 560 025

Copy to:

➤ Fire station officer, South Fire station, Bangalore-560025.